

Product Notice

January 15, 2015


Subject: Fig. 077, 535, 535B, 535BDI, 535DI

This notice is from Morrison Bros. Co. to all distributors, purchasers, installers, and anyone who currently owns and/or operates the following Morrison Bros. Co. valves:

077---0200 AV	535---0100 AV	535---0300 AV	535B—0100 AV
535B—0300 AV	535BDI0300 AV	535DI-0300 AV	

It has become known to Morrison Bros. Co. that a small number of these valves, shipped between 10/20/14 and 1/12/15, may have been built with an incorrect spring in the expansion relief device. This spring controls the pressure at which the expansion relief device, inside these valves, opens to relieve expansion pressure that might build against a closed valve. If you have a valve that was built with this incorrect spring, the expansion relief feature will relieve liquid constantly. This means a small stream of liquid will be allowed to flow constantly from the downstream side of the valve, through a 0.125" hole, to the upstream side of the valve.

If you wish to inspect the spring in the valve you have, please see the pictures below.

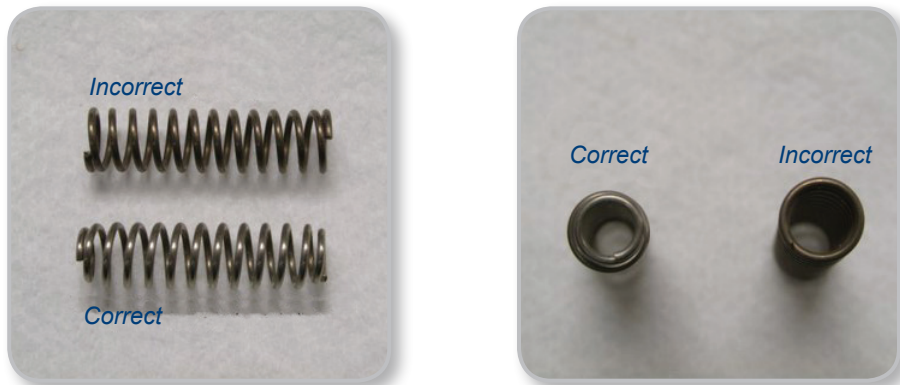

If you need guidance on how to inspect the spring, replacement springs, or a return authorization (RMA) to return your valve for repair, please contact our customer service department at (800) 553-4840 or custserv@morbros.com.

Morrison products are sold through authorized distributors. We must ask our distributors to forward this notice to any of their customers who purchased one of the valves listed above.


Rick Zillig
Director QCCS